


ROOF SYSTEM REPAIR NOTES:


1. REPLACE RIDGE BEAM
2. REPAIR BROKEN RAFTER. (SEE DETAIL 1.)
3. INSTALL NEW COLLAR TIES.
4. INSTALL 1/2" PLYWOOD AS NEEDED NAILED 4" O.C. ALONG EDGES AND 8" O.C. IN THE FIELD
5. INSTALL NEW METAL ROOFING OVER TITANIUM UNDERLAYMENT

RAFTERS TO BE REPAIRED MARKED WITH (X) AT DAMAGED OR BROKEN AREA

THIS RAFTER WILL HAVE A CONTINUOUS REPAIR TO BOTH SIDES DUE TO LOCATION OF BREAK.

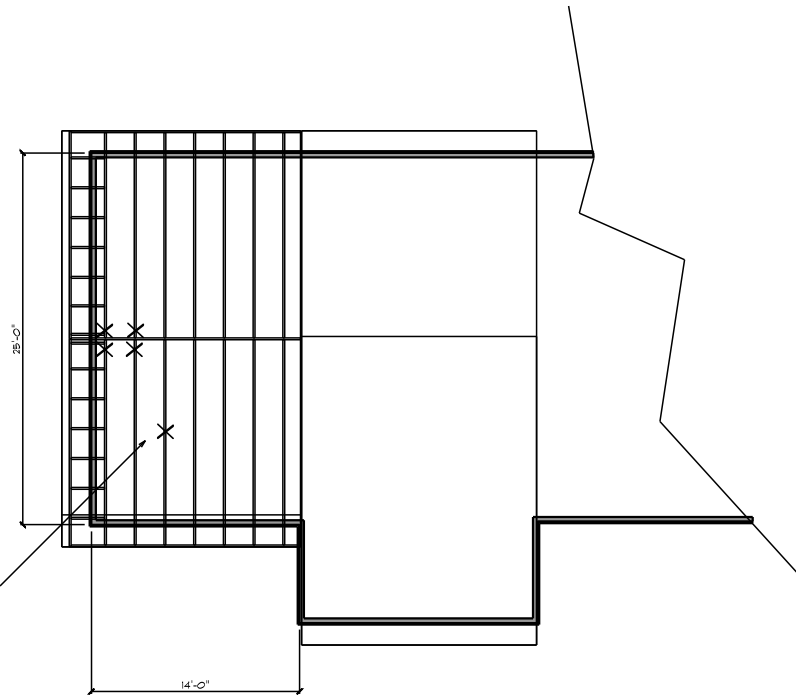

DETAIL 1

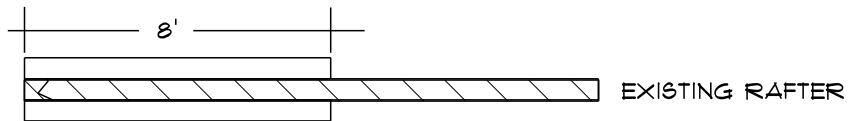

2X6 RAFTER REPAIR:

ADD 2X6 S.Y.P. MINIMUM OF 8' TO BOTH SIDES OF DAMAGED RAFTERS (5)  
 NAIL WITH 12 PENNY NAILS 2 ROWS 6" O.C.  
 RE NAIL ROOF WITH 8D .131 NAILS 4" ALONG EDGES AND 8" IN FIELD



EXISTING & REMODEL  
 PLANS

Drawn By: ERIC CAMERON  
 DATE: 07/01/20

MCKINZEY REMODEL

CONTRACTOR: ERIC CAMERON  
 ERIC CAMERON CONSTRUCTION, INC.  
 15601 N.W. 298TH STREET  
 HIGH SPRINGS, FL 32643  
 CBC135166/3  
 352-454-0112

SHEET NO.  
 8