

**Mark Disosway, P.E.**

163 SW Midtown Place, Suite 103 Lake City, FL 32025, Ph (386) 754-5419

8/4/20


Columbia County Building Department

Re: Amira Builders / Zasciurinkas Res. / Parcel ID: R10006-238 Columbia County, FL

To whom it may concern:


This letter is in reference to inspection issues on the above referenced project.

1. At the rear wall of the house the framer did not have enough room to put in all the jacks and king studs we call for. Below are the fixes.

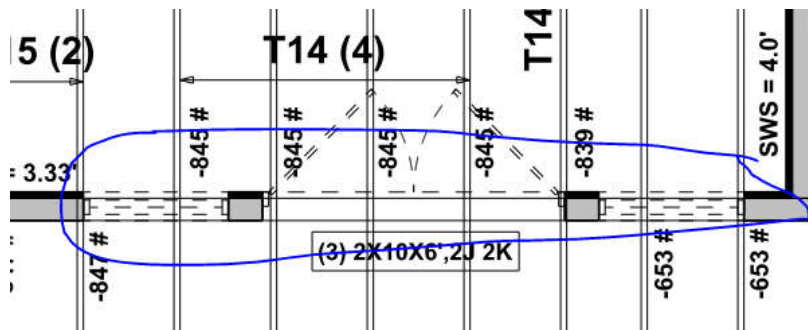

a.

At this location run the header continuous over the two side windows with (3) kings & (2) Jacks each end & (2) jacks mid points. Also box out the header with (2) 2x6 (1) top & (1) bottom of header. Also add HTT4 hold down bottom each end & (2) MSTA24 top each end.

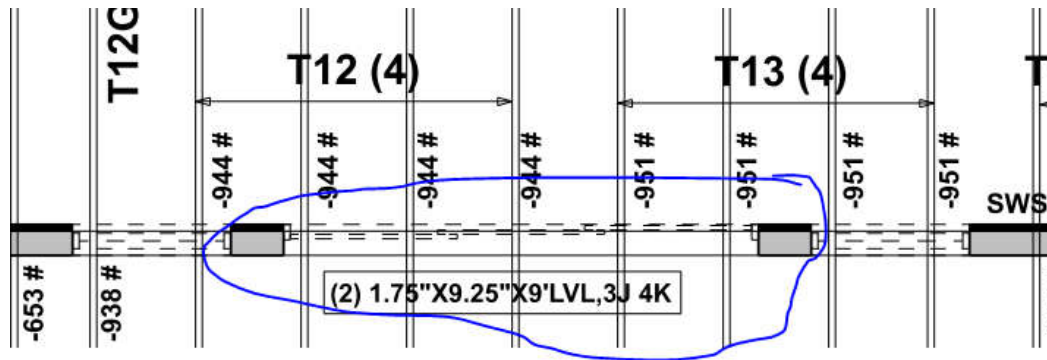

b.

At this location it is ok to use (4) kings & (2) Jacks each end. Also add HTT4 hold down bottom each end & (2) MSTA24 top each end.

THIS PDF HAS DIGITAL SIGNATURE  
AND ELECTRONIC SEAL. PRINTED  
COPIES ARE NOT CONSIDERED  
SIGNED OR SEALED. YOU MUST  
VERIFY SIGNATURE ON THIS PDF.  
[CLICK HERE TO VERIFY.](#)



Mark Disosway, PE  
Florida Professional Engineer #53915