
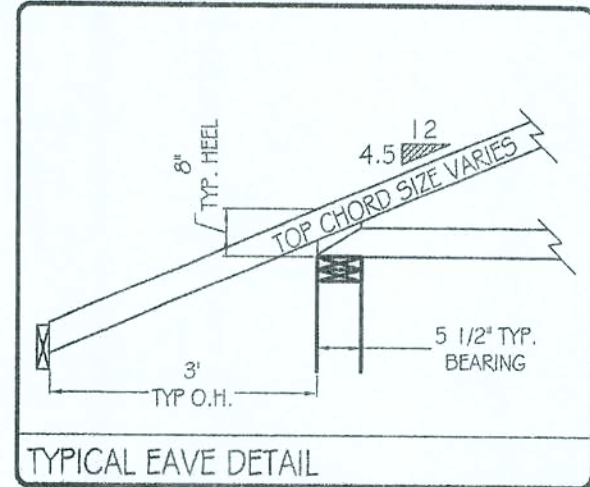


[illegible]

HAVEN HOSPICE – LAKE CITY AREA A Furniture Plan

Customer Signature /Date	7
Scale: 1/4"=1'	5
Checked by: MA	4
Drawn by: SL	3
Project #: 42307	2
Date: 01.10.06	1
Revisions	01.10.06 Original Layout

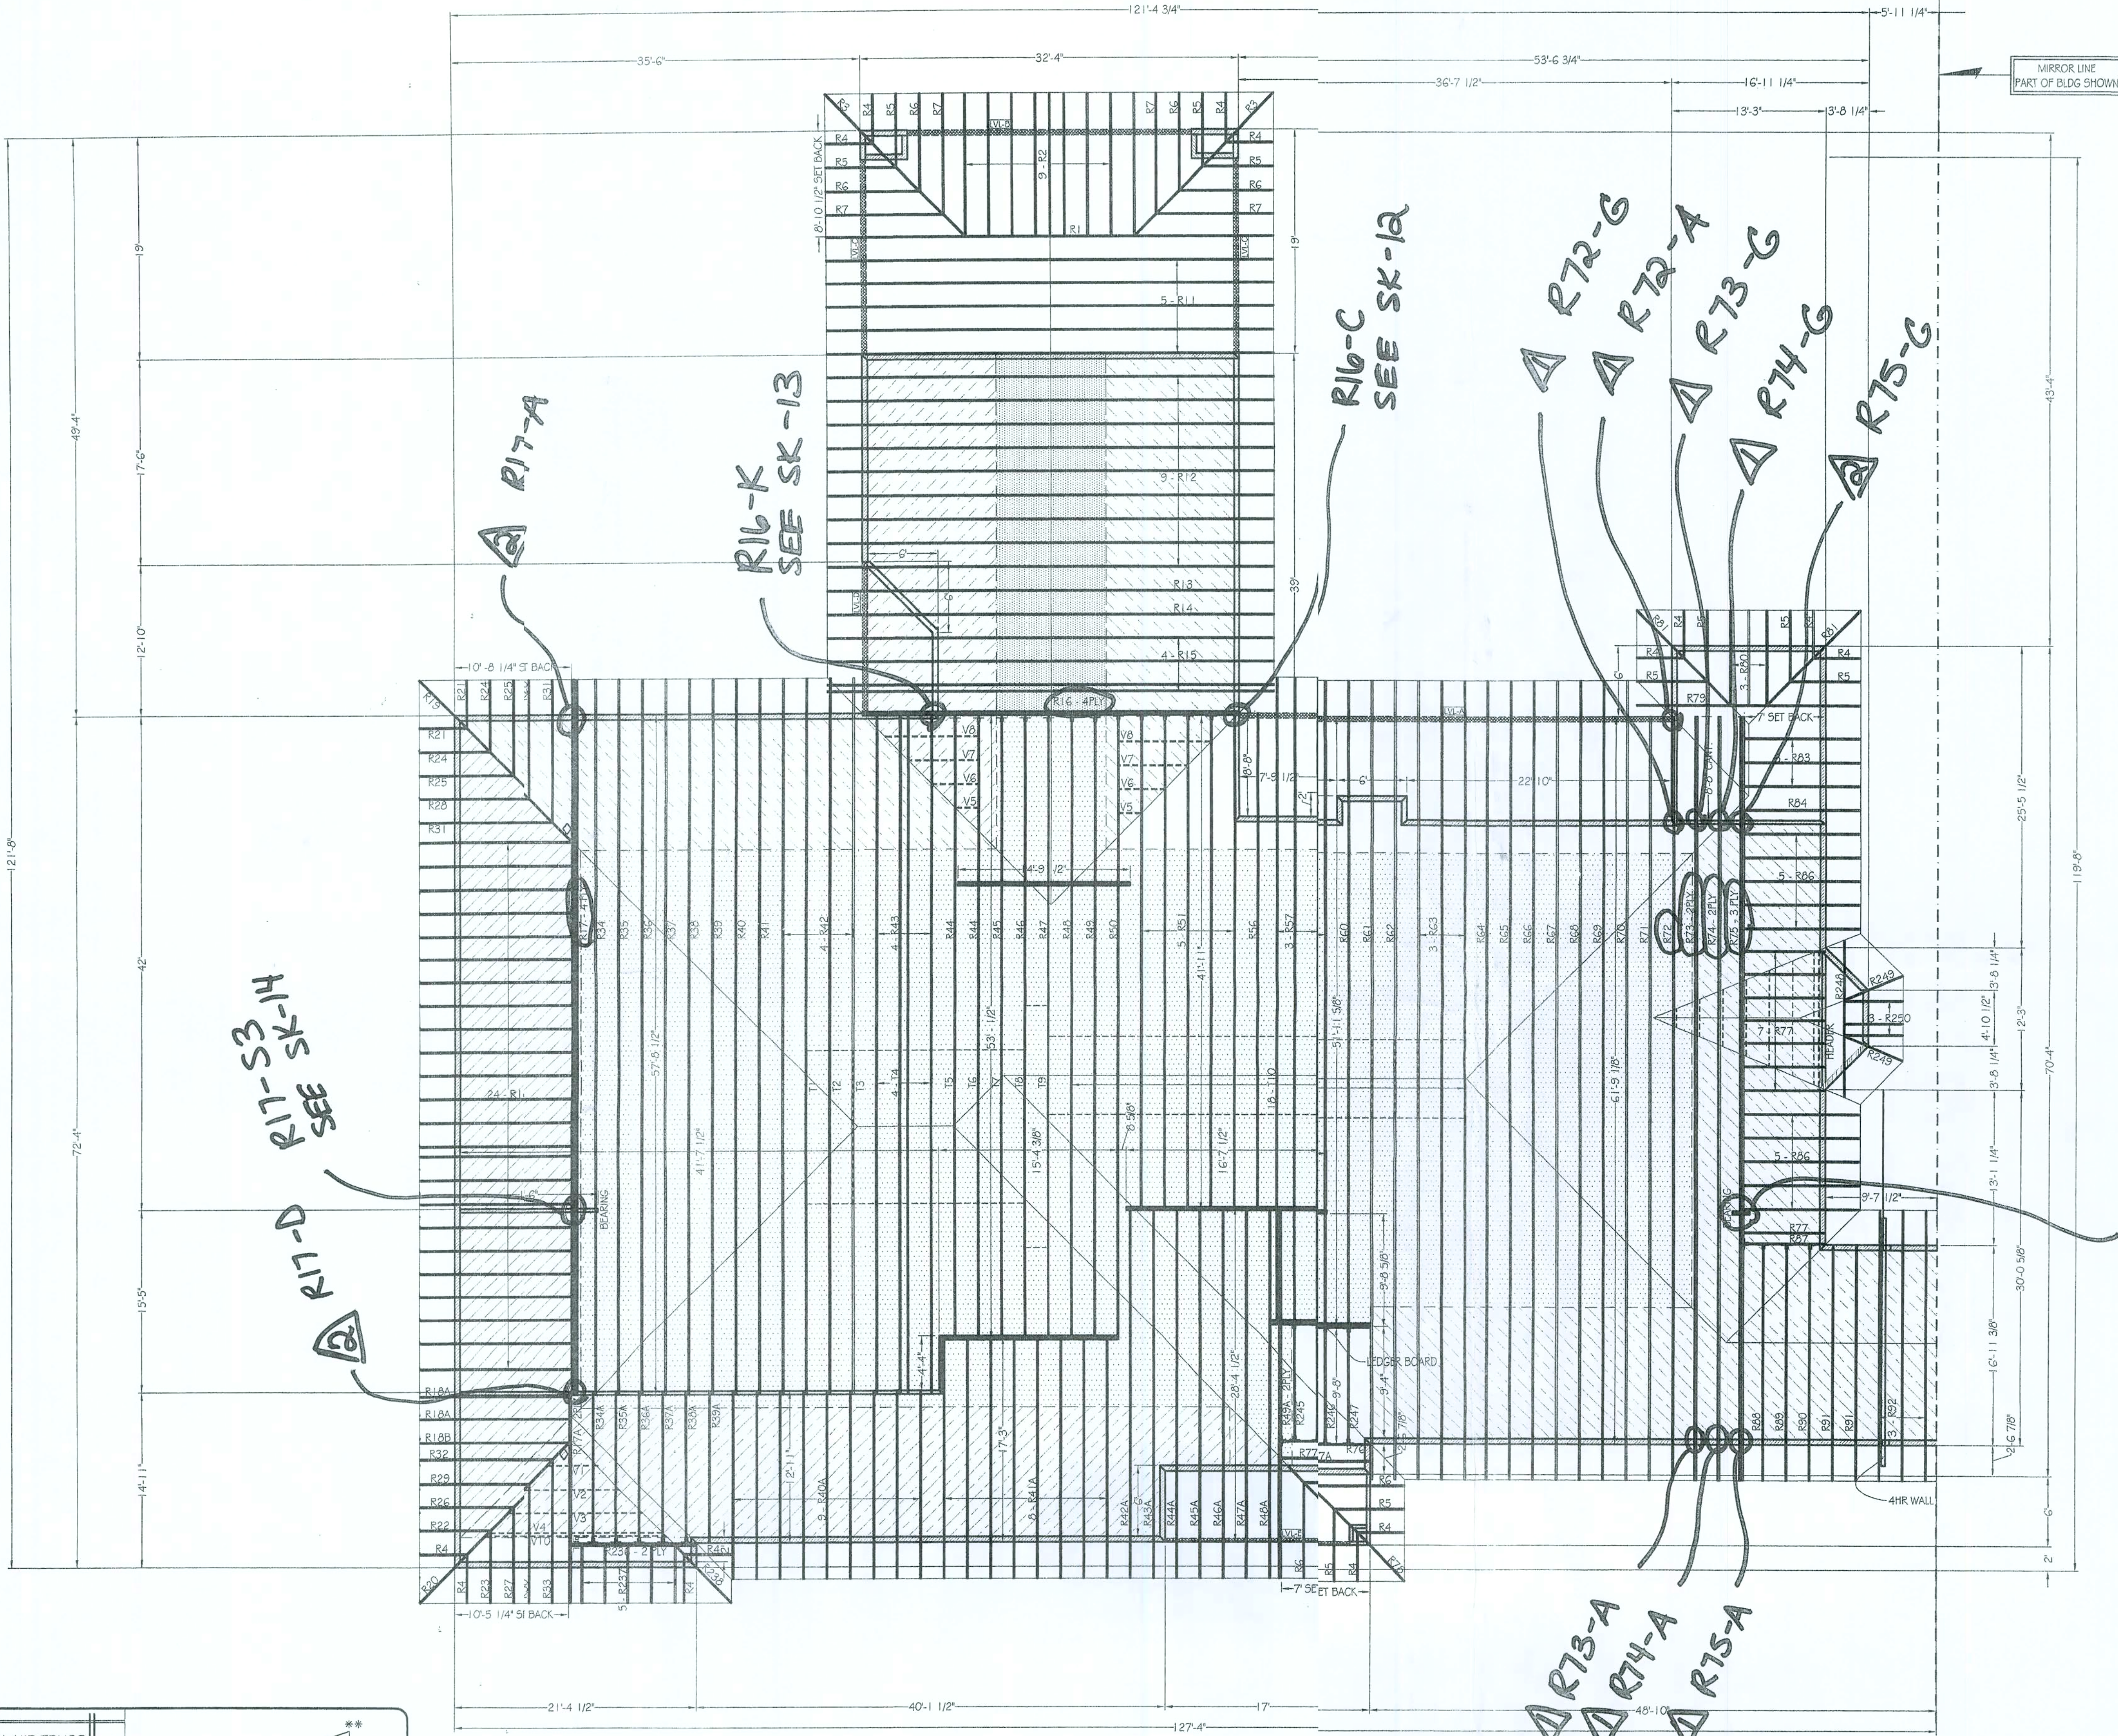

LEGEND	
	SUPPLIED BEAM
	BEAM BY OTHERS
	VALLEY / FIELD FRAMING
	PLUMBING DROP
	SLOPED CEILING
	RAISED FLAT CEILING
	10'-4 1/2\"/>
	12'-8\"/>
SYMBOL: L For Nailing: See Simpson Catalog or Call 1-800-999-5399	
QTY: 28 SIMPSON HUS26	
SYMBOL: L For Nailing: See Simpson Catalog or Call 1-800-999-5399	
QTY: 1 SIMPSON HHU526-2	
SYMBOL: L For Nailing: See Simpson Catalog or Call 1-800-999-5399	
QTY: 1 Left 1 Right SIMPSON THJA26	


KEY PLAN

BEAM SCHEDULE				
Contractor to verify all beam lengths prior to cutting.				
Mark	Length	Qty.	# Ply	Description
LVL-A	38'-0"	1	3	1-3/4"x 14" LVL Beam
LVL-B	32'-0"	1	3	1-3/4"x 14" LVL Beam
LVL-C	20'-0"	2	3	1-3/4"x 14" LVL Beam
LVL-D	14'-0"	1	3	1-3/4"x 11'-1/4" LVL Beam
LVL-E	18'-0"	1	3	1-3/4"x 11'-1/4" LVL Beam

HURRICANE CLIP SUBSTITUTION KEY

- (1) SIMPSON LSTA 21
- (2) SIMPSON LSTA 21


"WARNING"
FAILURE TO FOLLOW RECOMMENDATIONS IN "BCSI-B1" COULD RESULT IN SEVERE PERSONAL INJURY, LOSS OF LIFE OR PROPERTY DAMAGE

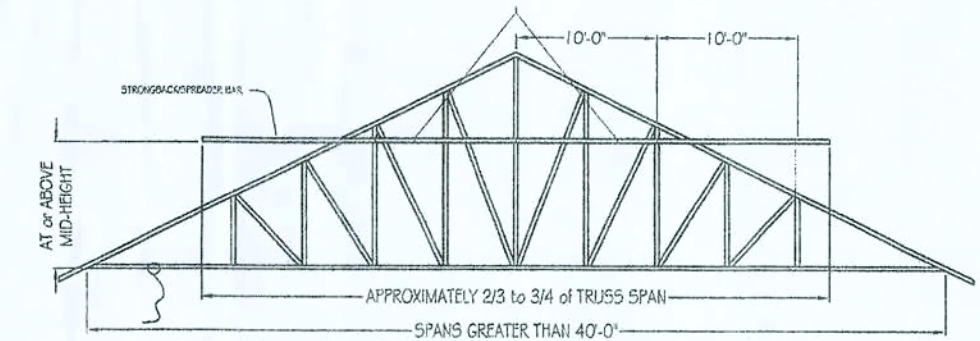




FOR ERECTION INSTRUCTIONS SEE BCSI-B1 IN ENGINEERING BOOK

REVIEWED AS NOTED
REVISOR: [Signature]
DATE: 12/2/06

"WARNING"
DO NOT USE SHORT BLOCKS TO BRACE FROM INDIVIDUAL TRUSSES

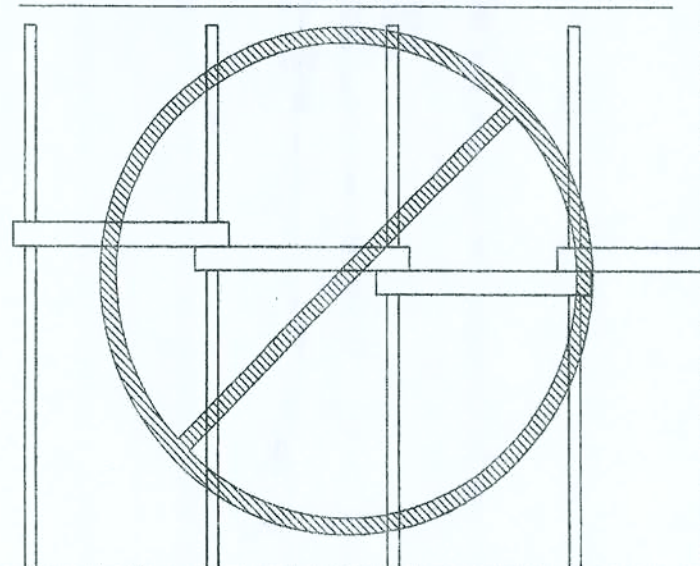

- "ATTENTION"**
- LIMITED RESPONSIBILITY OF ROOF TRUSS MANUFACTURER. SEE WTCA T-1995, SECTION 6.0, FOUND IN DESIGN MANUAL.
 - WARNING FAILURE TO FOLLOW RECOMMENDATIONS IN "BCSI-B1" MAY RESULT IN SERIOUS INJURY, LOSS OF LIFE, OR PROPERTY DAMAGE.
 - CUSTOMER TO VERIFY ALL DIMENSIONS, BEARING HEIGHTS, PITCHES AND ALL INFORMATION REGARDING THE DESIGN AND FABRICATION OF TRUSS SYSTEM.
 - DO NOT OVERLOAD TRUSSES w/ SHEETROCK / SHEATHING OR OTHER BUILDING MATERIALS.
 - TRUSSES ARE NOT MARKED IN ANY WAY TO IDENTIFY THE FREQUENCY, OR LOCATION OF TEMPORARY ERECTION BRACING. ALL TEMPORARY BRACING SHALL COMPLY WITH THE LATEST EDITION OF BCSI-B1 PUBLISHED BY THE TRUSS PLATE INSTITUTE FOUND IN THE DESIGN MANUAL.
 - NON-LOAD BEARING WALLS TO BE SINGLE TOP PLATED, TO PREVENT LOAD TRANSFER TO THESE WALLS. A 1x4 MAY BE USED AS SECOND TOP PLATE.

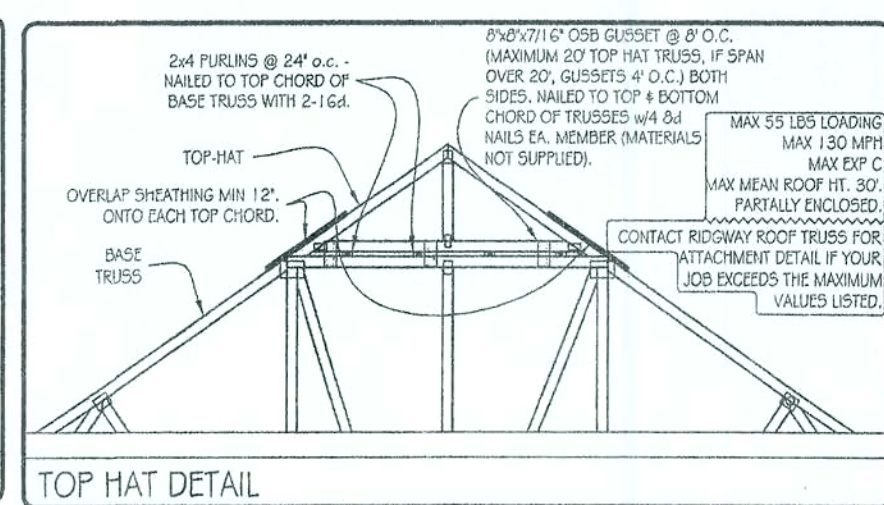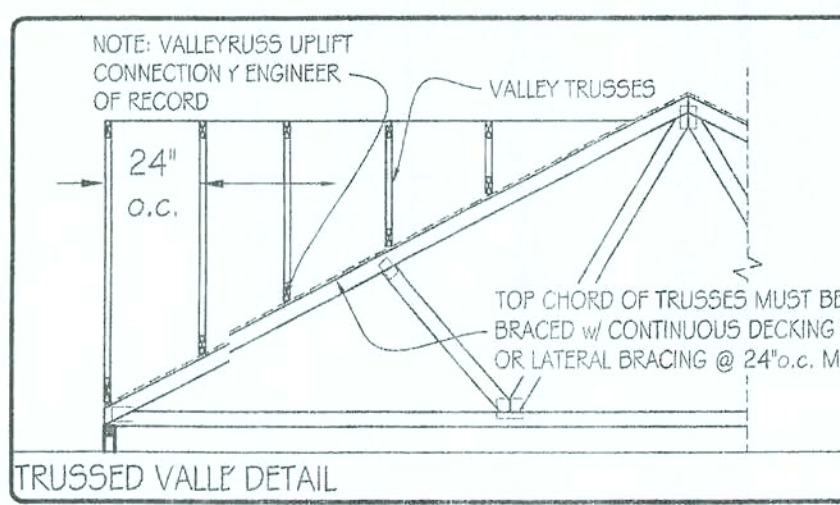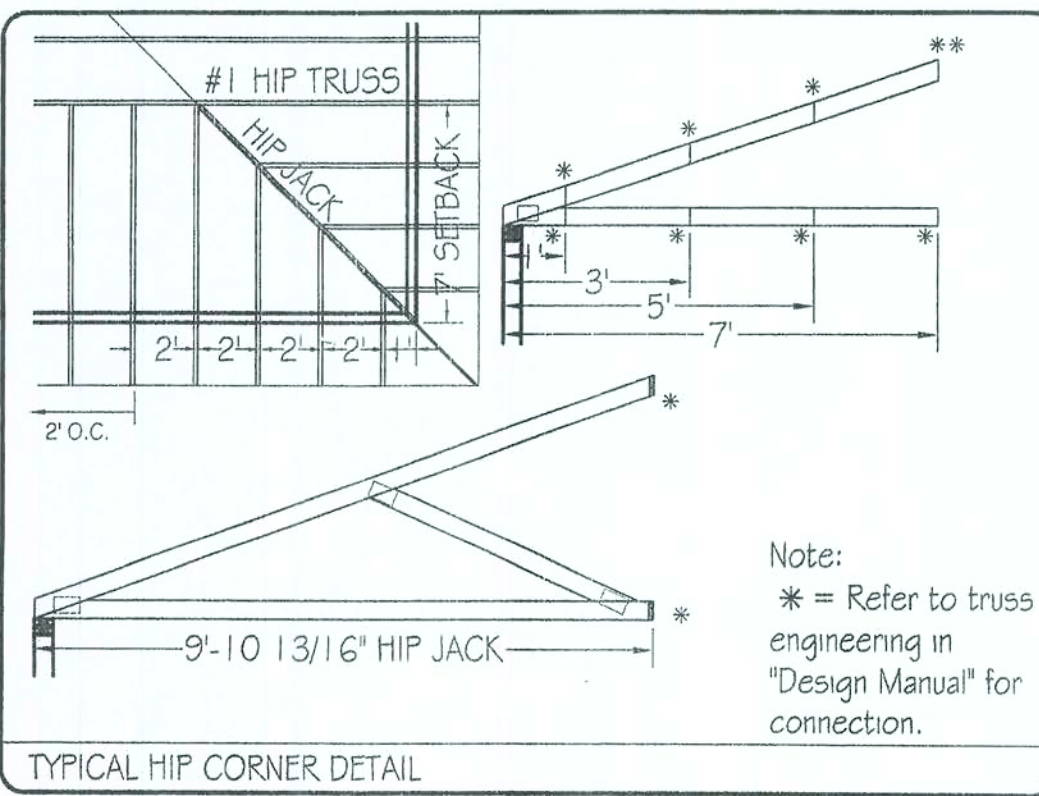


OFFICE BUILDING

SPUTO and LAMMERT
ENGINEERING, LLC
STRUCTURAL ENGINEERS


REVIEWED AS NOTED
REVISOR: [Signature]
DATE: 12/2/06

THIS DOCUMENT HAS BEEN REVIEWED FOR GENERAL CONFORMANCE WITH DESIGN CONCEPTS AND GENERAL AGREEMENT WITH CONTRACT DOCUMENTS. SUCH REVIEW DOES NOT RELIEVE THE CONTRACTOR OF ANY RESPONSIBILITY FOR THE WORK.

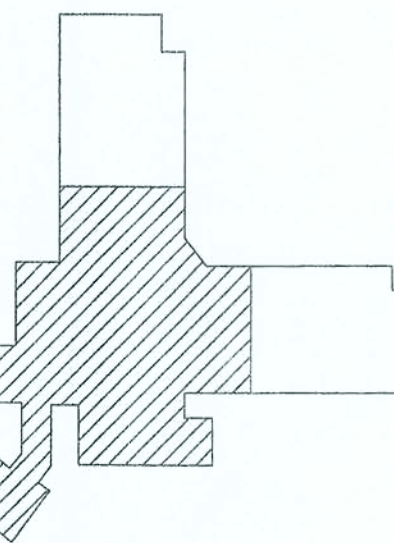

LEGEND	
	SUPPLIED BEAM
	BEAM BY OTHERS
	VALLEY / FIELD FRAMING
	PLUMBING DROP
	SLOPED CEILING
	RAISED FLAT CEILING
	10'-4" 1/2" BEARING HEIGHT
	12'-8" BEARING HEIGHT
	13'-6" BEARING HEIGHT
SYMBOL:  For Nail QTY: 78 See Simpson Catalog or Call 1-800-939-5050	
SIMPSON HGU526	
SYMBOL:  For Nail QTY: 4 See Simpson Catalog or Call 1-800-939-5050	
SIMPSON HGU528-2	
SYMBOL:  For Nail QTY: 4 See Simpson Catalog or Call 1-800-939-5050	
SIMPSON HGU526-2	
SYMBOL:  For Nail QTY: 1 See Simpson Catalog or Call 1-800-939-5050	
SIMPSON HGU528-3	
SYMBOL:  For Nail QTY: 1 Left See Simpson Catalog or Call 1-800-939-5050	
SIMPSON THJA26	


BEAM SCHEDULE				
Contractor to verify all beam lengths prior to cutting.				
Mark	5kip Length	Qty.	# Ply	Description
LVL-F	22'-0"	1	3	1-3/4"x 16" LVL Beam
LVL-G	22'-0"	2	3	1-3/4"x 11'-1/4" LVL Beam
LVL-H	16'-0"	2	3	1-3/4"x 11'-1/4" LVL Beam
LVL-I	26'-0"	1	3	1-3/4"x 11'-1/4" LVL Beam

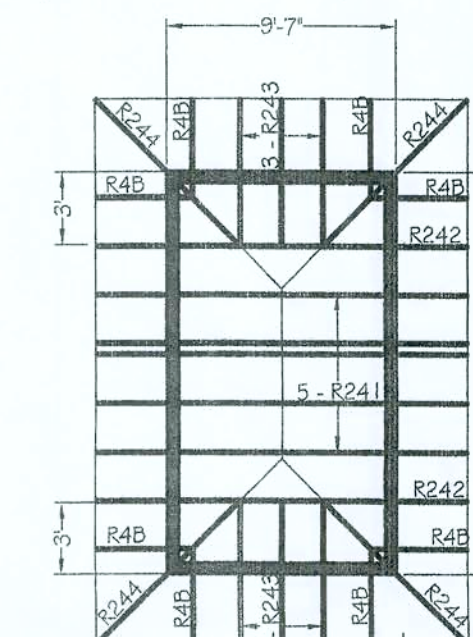


HURRICANE CLIP SUBSTITUTION KEY

- (1) SIMPSON LSTA 21
- (2) SIMPSON LSTA 21

"WARNING"
FAILURE TO FOLLOW RECOMMENDATIONS IN "BCSI-B1" COULD RESULT IN
SEVERE PERSONAL INJURY, LOSS OF LIFE OR PROPERTY DAMAGE

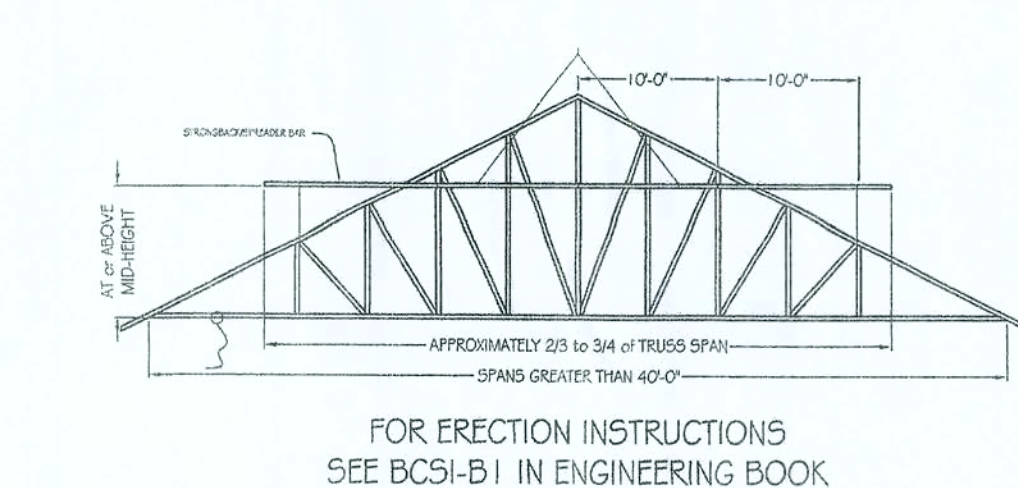


"WARNING"
DO NOT USE SHORT BLOCKS TO
BRACE FROM INDIVIDUAL TRUSSES

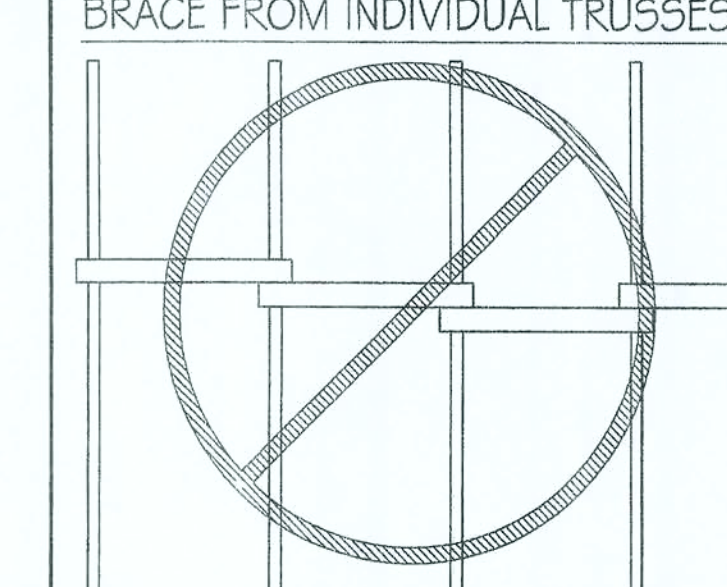


"ATTENTION"


1. LIMITED RESPONSIBILITY OF ROOF TRUSS MANUFACTURER. SEE VTCA 1-1995, SECTION 6.0, FOUND IN DESIGN MANUAL.
2. WARNING FAILURE TO FOLLOW RECOMMENDATIONS IN "BCSI-B1" MAY RESULT IN SERIOUS INJURY, LOSS OF LIFE, OR PROPERTY DAMAGE.
3. CUSTOMER TO VERIFY ALL DIMENSIONS, BEARING HEIGHTS, PITCHES AND ALL INFORMATION REGARDING THE DESIGN AND FABRICATION OF TRUSS SYSTEM.
4. DO NOT OVERLOAD TRUSSES w/ SHEETROCK / SHEATHING OR OTHER BUILDING MATERIALS.
5. TRUSSES ARE NOT MARKED IN ANY WAY TO IDENTIFY THE FREQUENCY, OR LOCATION OF TEMPORARY ERECTION BRACING. A TEMPORARY BRACING SHALL COMPLY WITH THE LATEST EDITION OF BCSI-B1 PUBLISHED BY THE TRUSS PLATE INSTITUTE FOUND IN THE DESIGN MANUAL.
6. NON-LOAD BEARING WALLS TO BE SINGLE TOP PLATED, TO PREVENT LOAD TRANSFER TO THESE WALLS. A 1x4 MAY BE USED AS SECOND TOP PLATE.

 Ridgway Roof Truss Company P.O. Box 1309 Gainesville, Florida 32602 Telephone (352) 376-4436 FAX (352) 371-3316 E-Mail: Sales@RidgwayTruss.com	 M.M. PARRISH CONSTRUCTION HOSPICE OF SUWANNEE VALLEY	SCALE: 1/8" = 1'-0"	ROOF TRUSS LAYOUT
Initial Check: _____ Design: TONY CAD: EDWARD Job: # 060039 Date: 1-1-06 File: K:\Jobs\060039\060039B	SALESMAN: MIKE WELDON REVISION DATE: 3-16-06	REV. BY: CHK. BY: MIKE WELDON	MISC. CHANGES
1	2	3	4
5	6	7	8
9	10	11	12
13	14	15	16
17	18	19	20
21	22	23	24
25	26	27	28
29	30	31	32
33	34	35	36
37	38	39	40
41	42	43	44
45	46	47	48
49	50	51	52
53	54	55	56
57	58	59	60
61	62	63	64
65	66	67	68
69	70	71	72
73	74	75	76
77	78	79	80
81	82	83	84
85	86	87	88
89	90	91	92
93	94	95	96
97	98	99	100

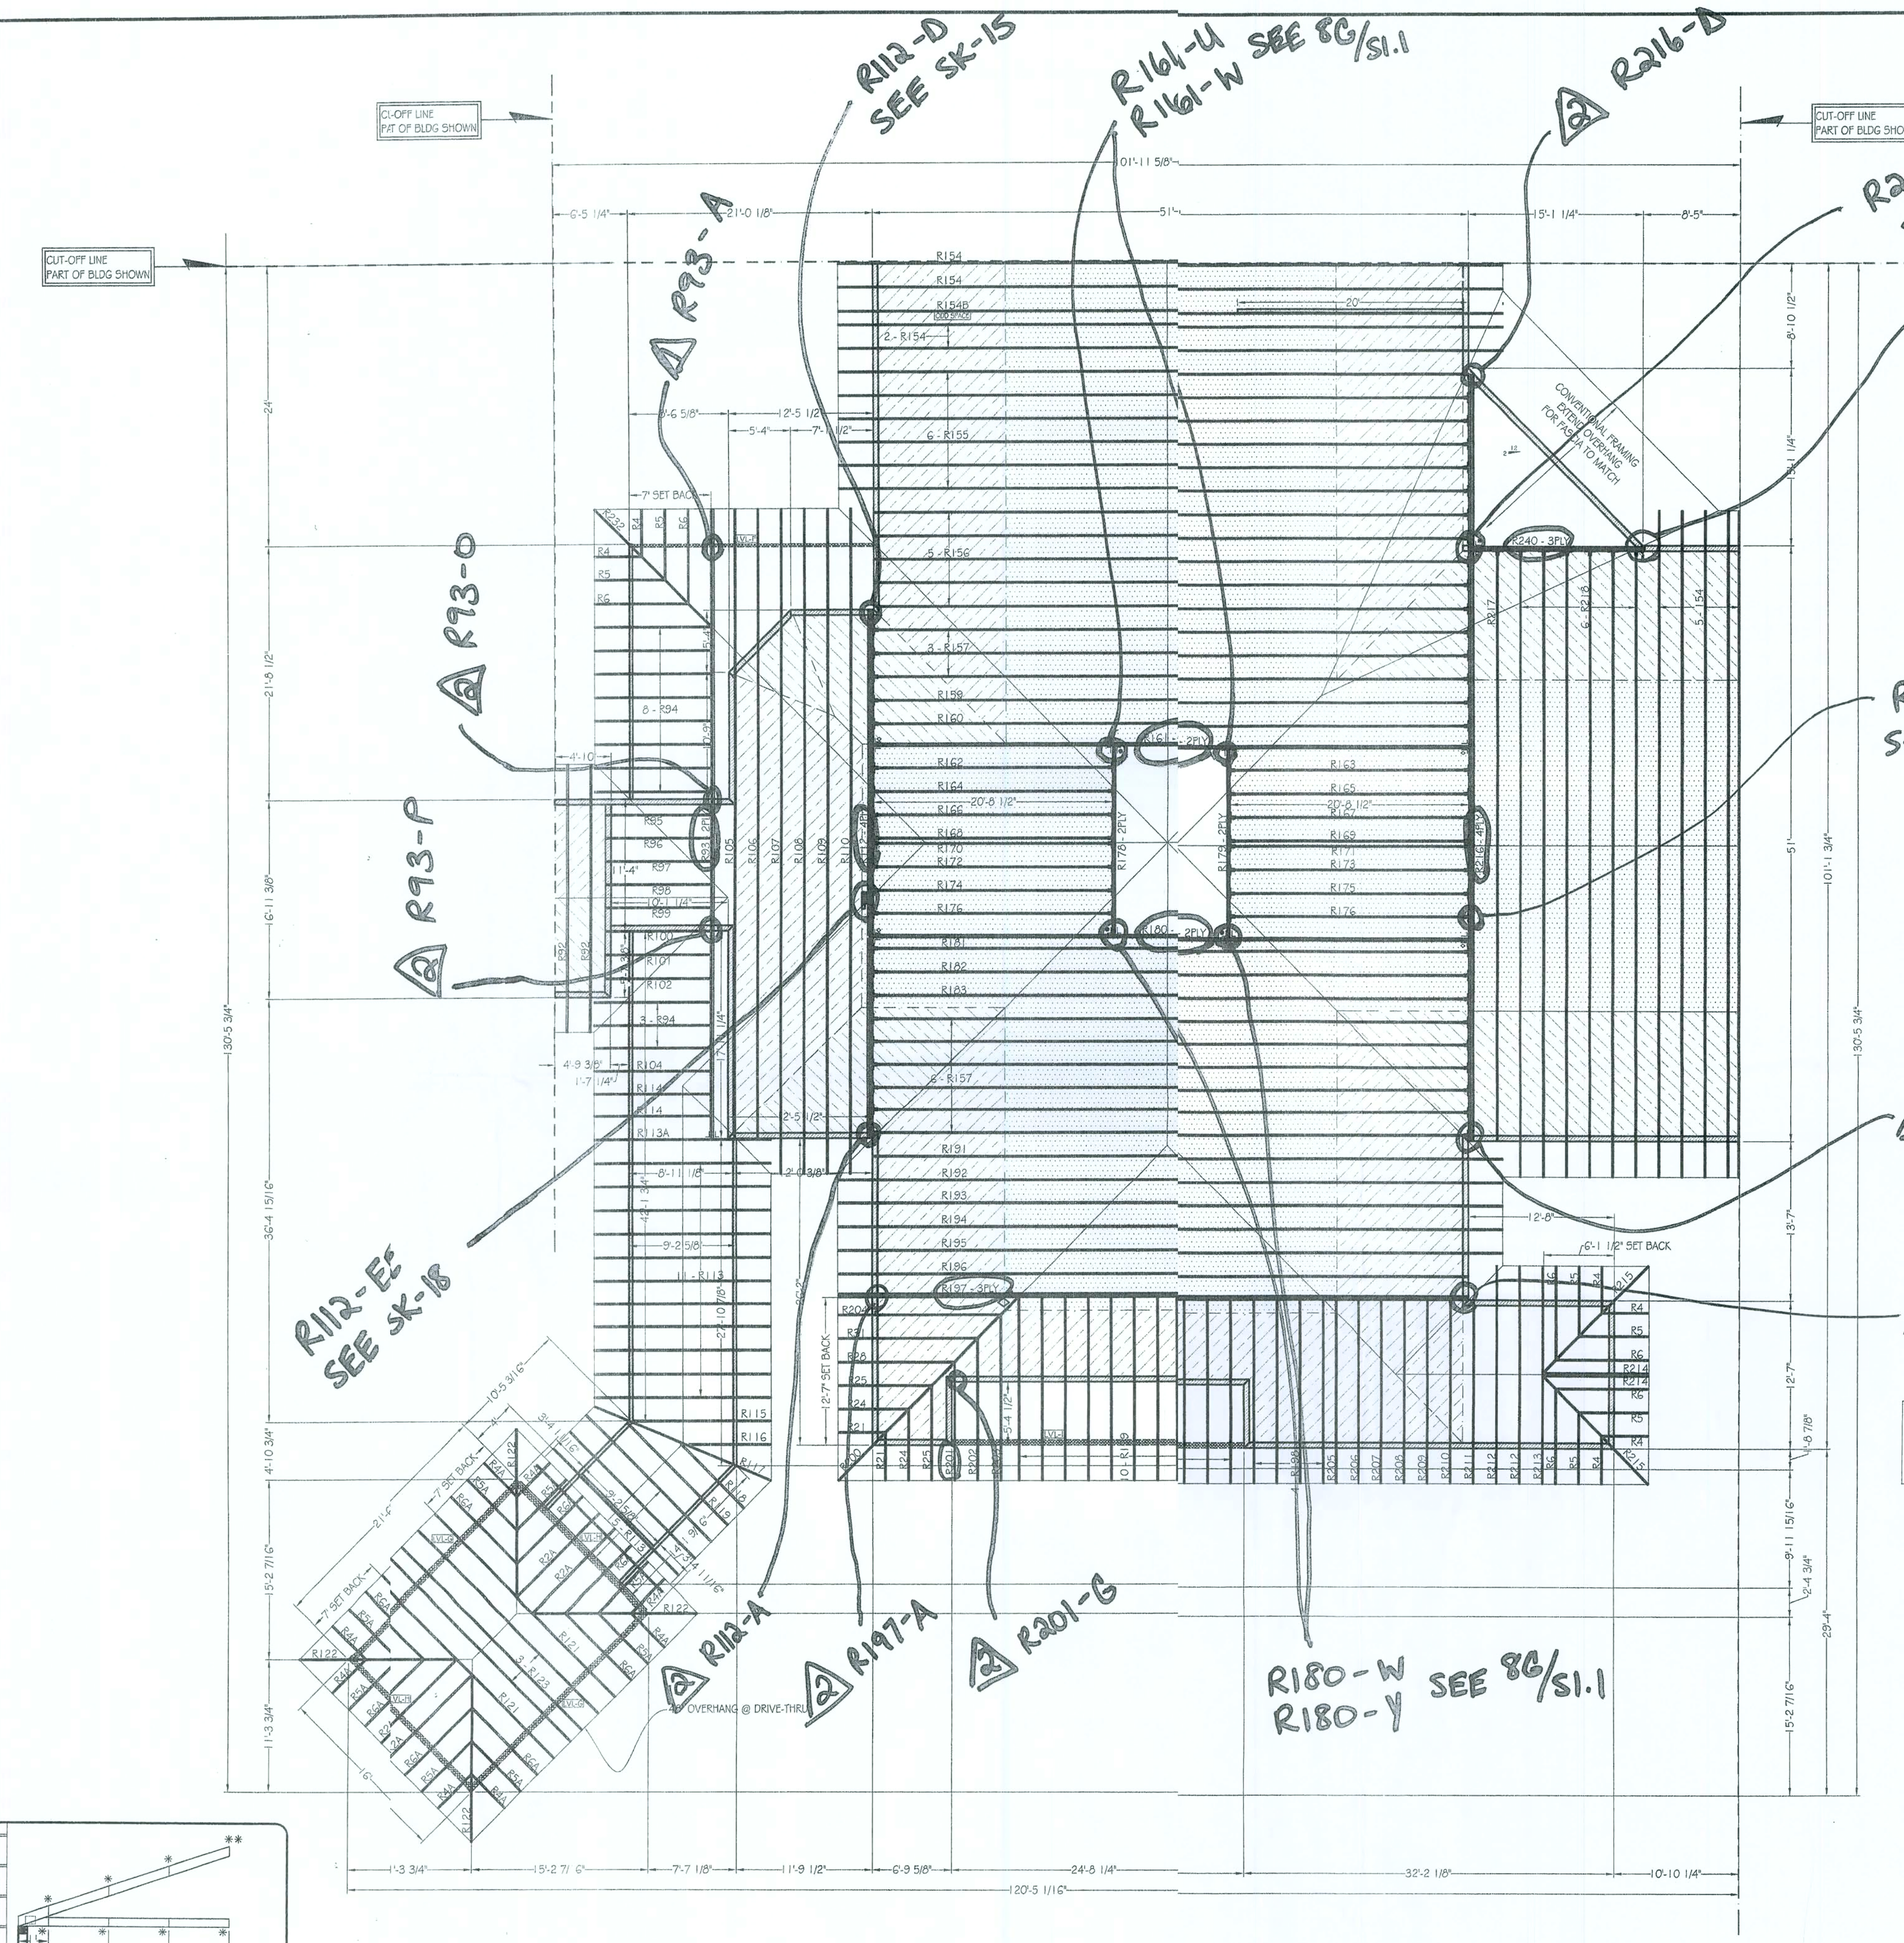


CARE CENTER

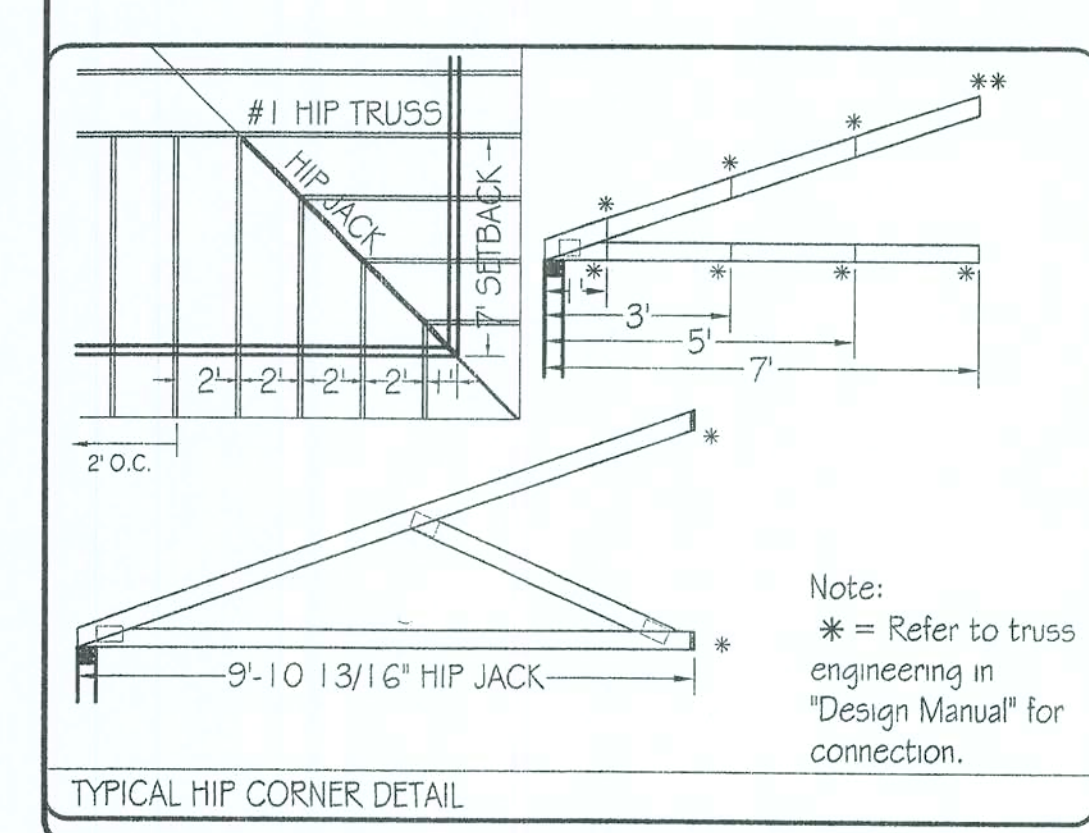


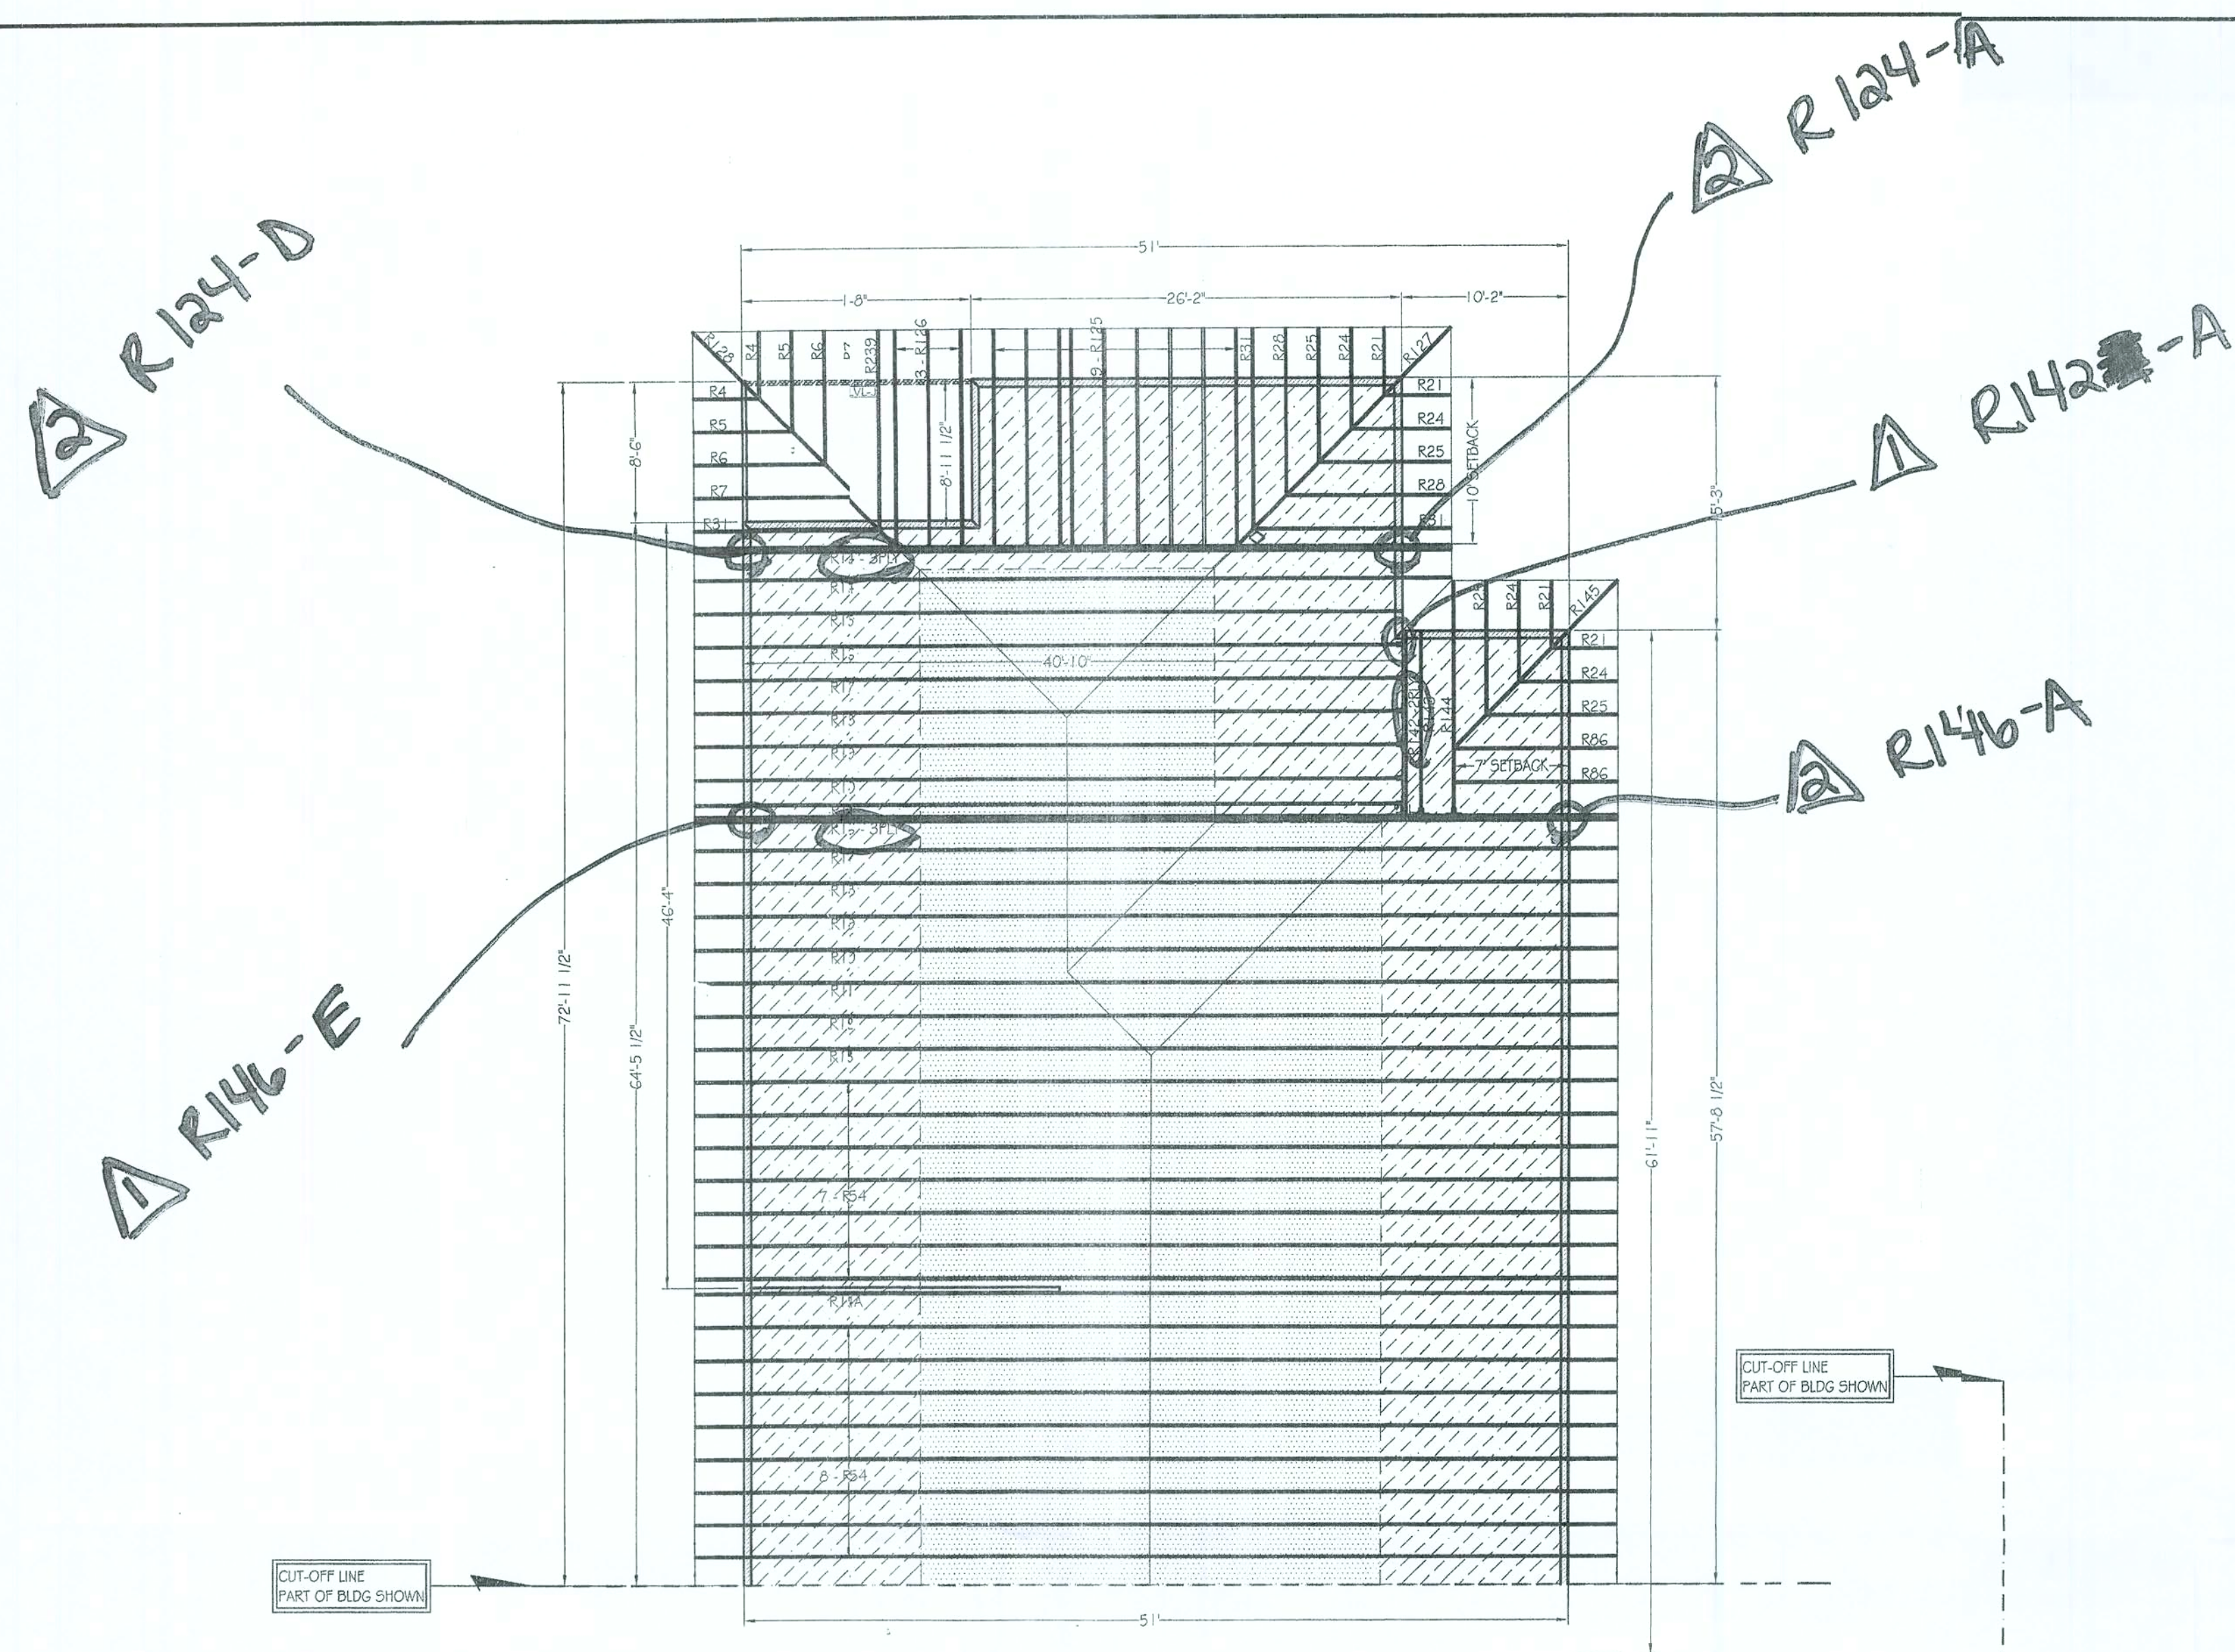


CARE CENTER

"WARNING"
FAILURE TO FOLLOW RECOMMENDATIONS IN "BCSI-B1" COULD RESULT IN SEVERE PERSONAL INJURY, LOSS OF LIFE OR PROPERTY DAMAGE

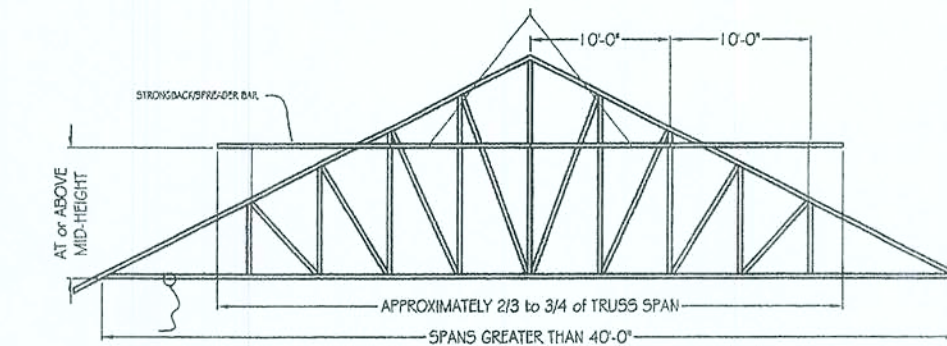

"WARNING"
DO NOT USE SHORT BLOCKS TO BRACE FROM INDIVIDUAL TRUSSES

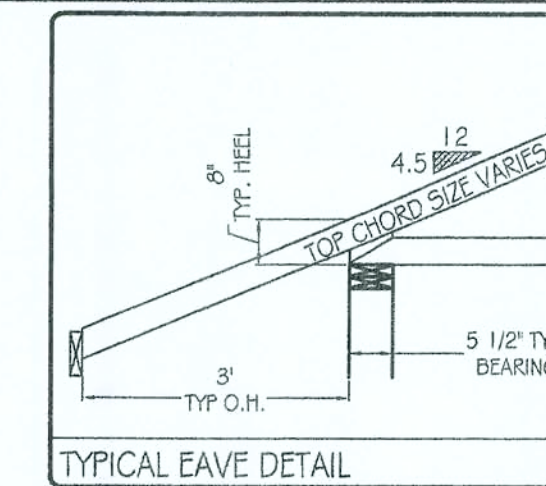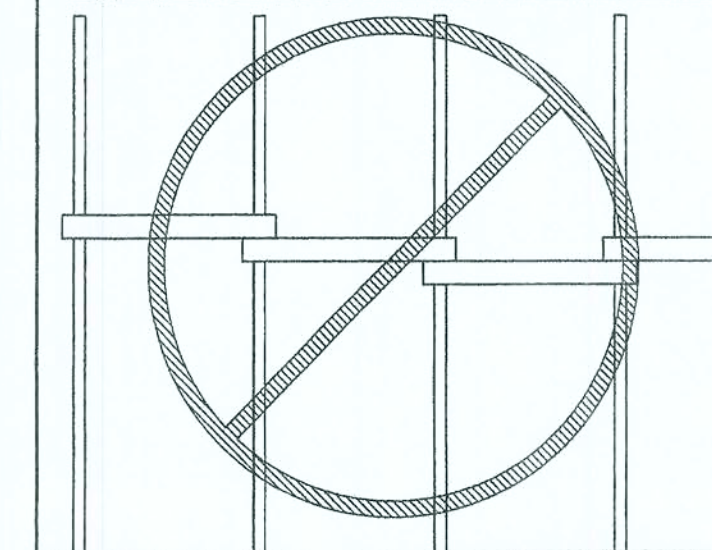


LEGEND	
[Symbol]	SUPPLIED BEAM
[Symbol]	BEAM BY OTHERS
[Symbol]	VALLEY / FIELD FRAMING
[Symbol]	PLUMBING DROP
[Symbol]	SLOPED CEILING
[Symbol]	RAISED FLAT CEILING
[Symbol]	10'-4 3/4" BEARING HT.
[Symbol]	25'-6" BEARING HEIGHT

SYMBOL: JL	For Hailing: See Simpson Catalog or Call 1-800-999-5099
QTY: 16	SIMPSON HU526
SYMBOL: JL	For Hailing: See Simpson Catalog or Call 1-800-999-5099
QTY: 2	SIMPSON HGUS26-2
SYMBOL: JL	For Hailing: See Simpson Catalog or Call 1-800-999-5099
QTY: 1 Left 1 Right	SIMPSON THJA26

BEAM SCHEDULE

Contractor to verify all beam lengths prior to cutting.

Mark	Ship Length	Qty	# Ply	Description
LVL-J	16'-0"	2	3	1-3/4"x 11'-1/4" LVL Beam

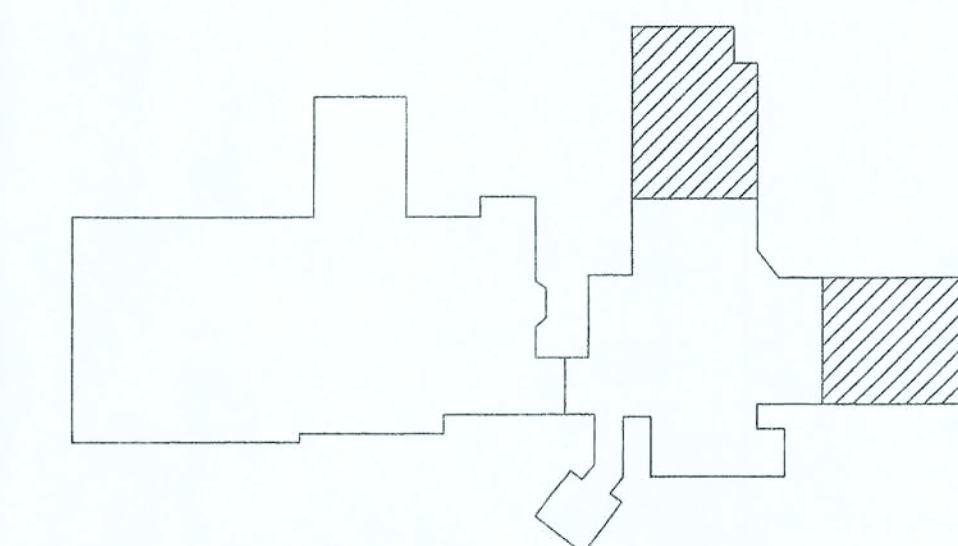

KEY PLAN

HURRICANE CLIP SUBSTITUTION KEY

- (1) SIMPSON LSTA 21
- (2) SIMPSON LSTA 21

"ATTENTION"
1. LIMITED RESPONSIBILITY OF ROOF TRUSS MANUFACTURER. SEE WTCA T-1995, SECTION 6.0, FOUND IN DESIGN MANUAL.


2. WARNING FAILURE TO FOLLOW RECOMMENDATIONS IN "BCSI-B1" MAY RESULT IN SERIOUS INJURY, LOSS OF LIFE, OR PROPERTY DAMAGE.

3. CUSTOMER TO VERIFY ALL DIMENSIONS, BEARING HEIGHTS, PITCHES AND ALL INFORMATION REGARDING THE DESIGN AND FABRICATION OF TRUSS SYSTEM.

4. DO NOT OVERLOAD TRUSSES w/ SHEETROCK / SHEATHING OR OTHER BUILDING MATERIALS.

5. TRUSSES ARE NOT MARKED IN ANY WAY TO IDENTIFY THE FREQUENCY, OR LOCATION OF TEMPORARY ERECTION BRACING ALL TEMPORARY BRACING SHALL COMPLY WITH THE LATEST EDITION OF BCSI-B1 PUBLISHED BY THE TRUSS PLATE INSTITUTE FOUND IN THE DESIGN MANUAL.

6. NON-LOAD BEARING WALLS TO BE SINGLE TOP PLATED, TO PREVENT LOAD TRANSFER TO THESE WALLS. A 1x4 MAY BE USED AS SECOND TOP PLATE.

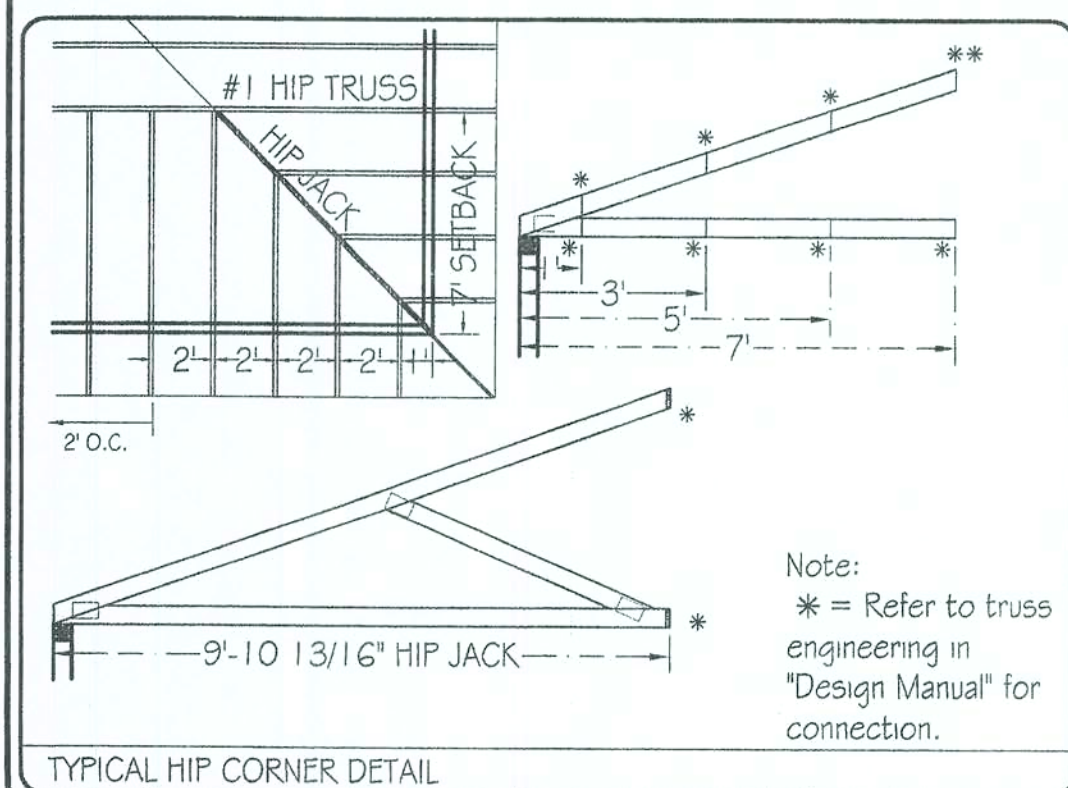

Note:
* = Refer to truss engineering in "Design Manual" for connection.

TYPICAL HIP CORNER DETAIL

ROOF TRUSS LAYOUT

SCALE:
1/8" = 1'-0"

M.M. PARRISH CONSTRUCTION
HOSPICE OF SUWANNEE VALLEY

Ridgway Roof Truss Company
P.O. Box 1309 Gainesville, Florida 32602
Telephone (352) 376-4436 FAX (352) 371-3316
E-Mail: Sales@RidgwayTruss.com

REV. BY	CHK. BY	DATE	REVISION
MIKE WELDON	MIKE WELDON	3-11-06	3-11-06

Salesman: MIKE WELDON
Initial Check: TONY CAD
Design: TONY CAD
Job: # 060000
Date: 1-1-06
File: K:\Jobs\060000\0600039

Page 3 of 3