
BOUNDARY SURVEY

IN SECTION 15 TOWNSHIP 4 SOUTH, RANGE 16 EAST COLUMBIA COUNTY, FLORIDA

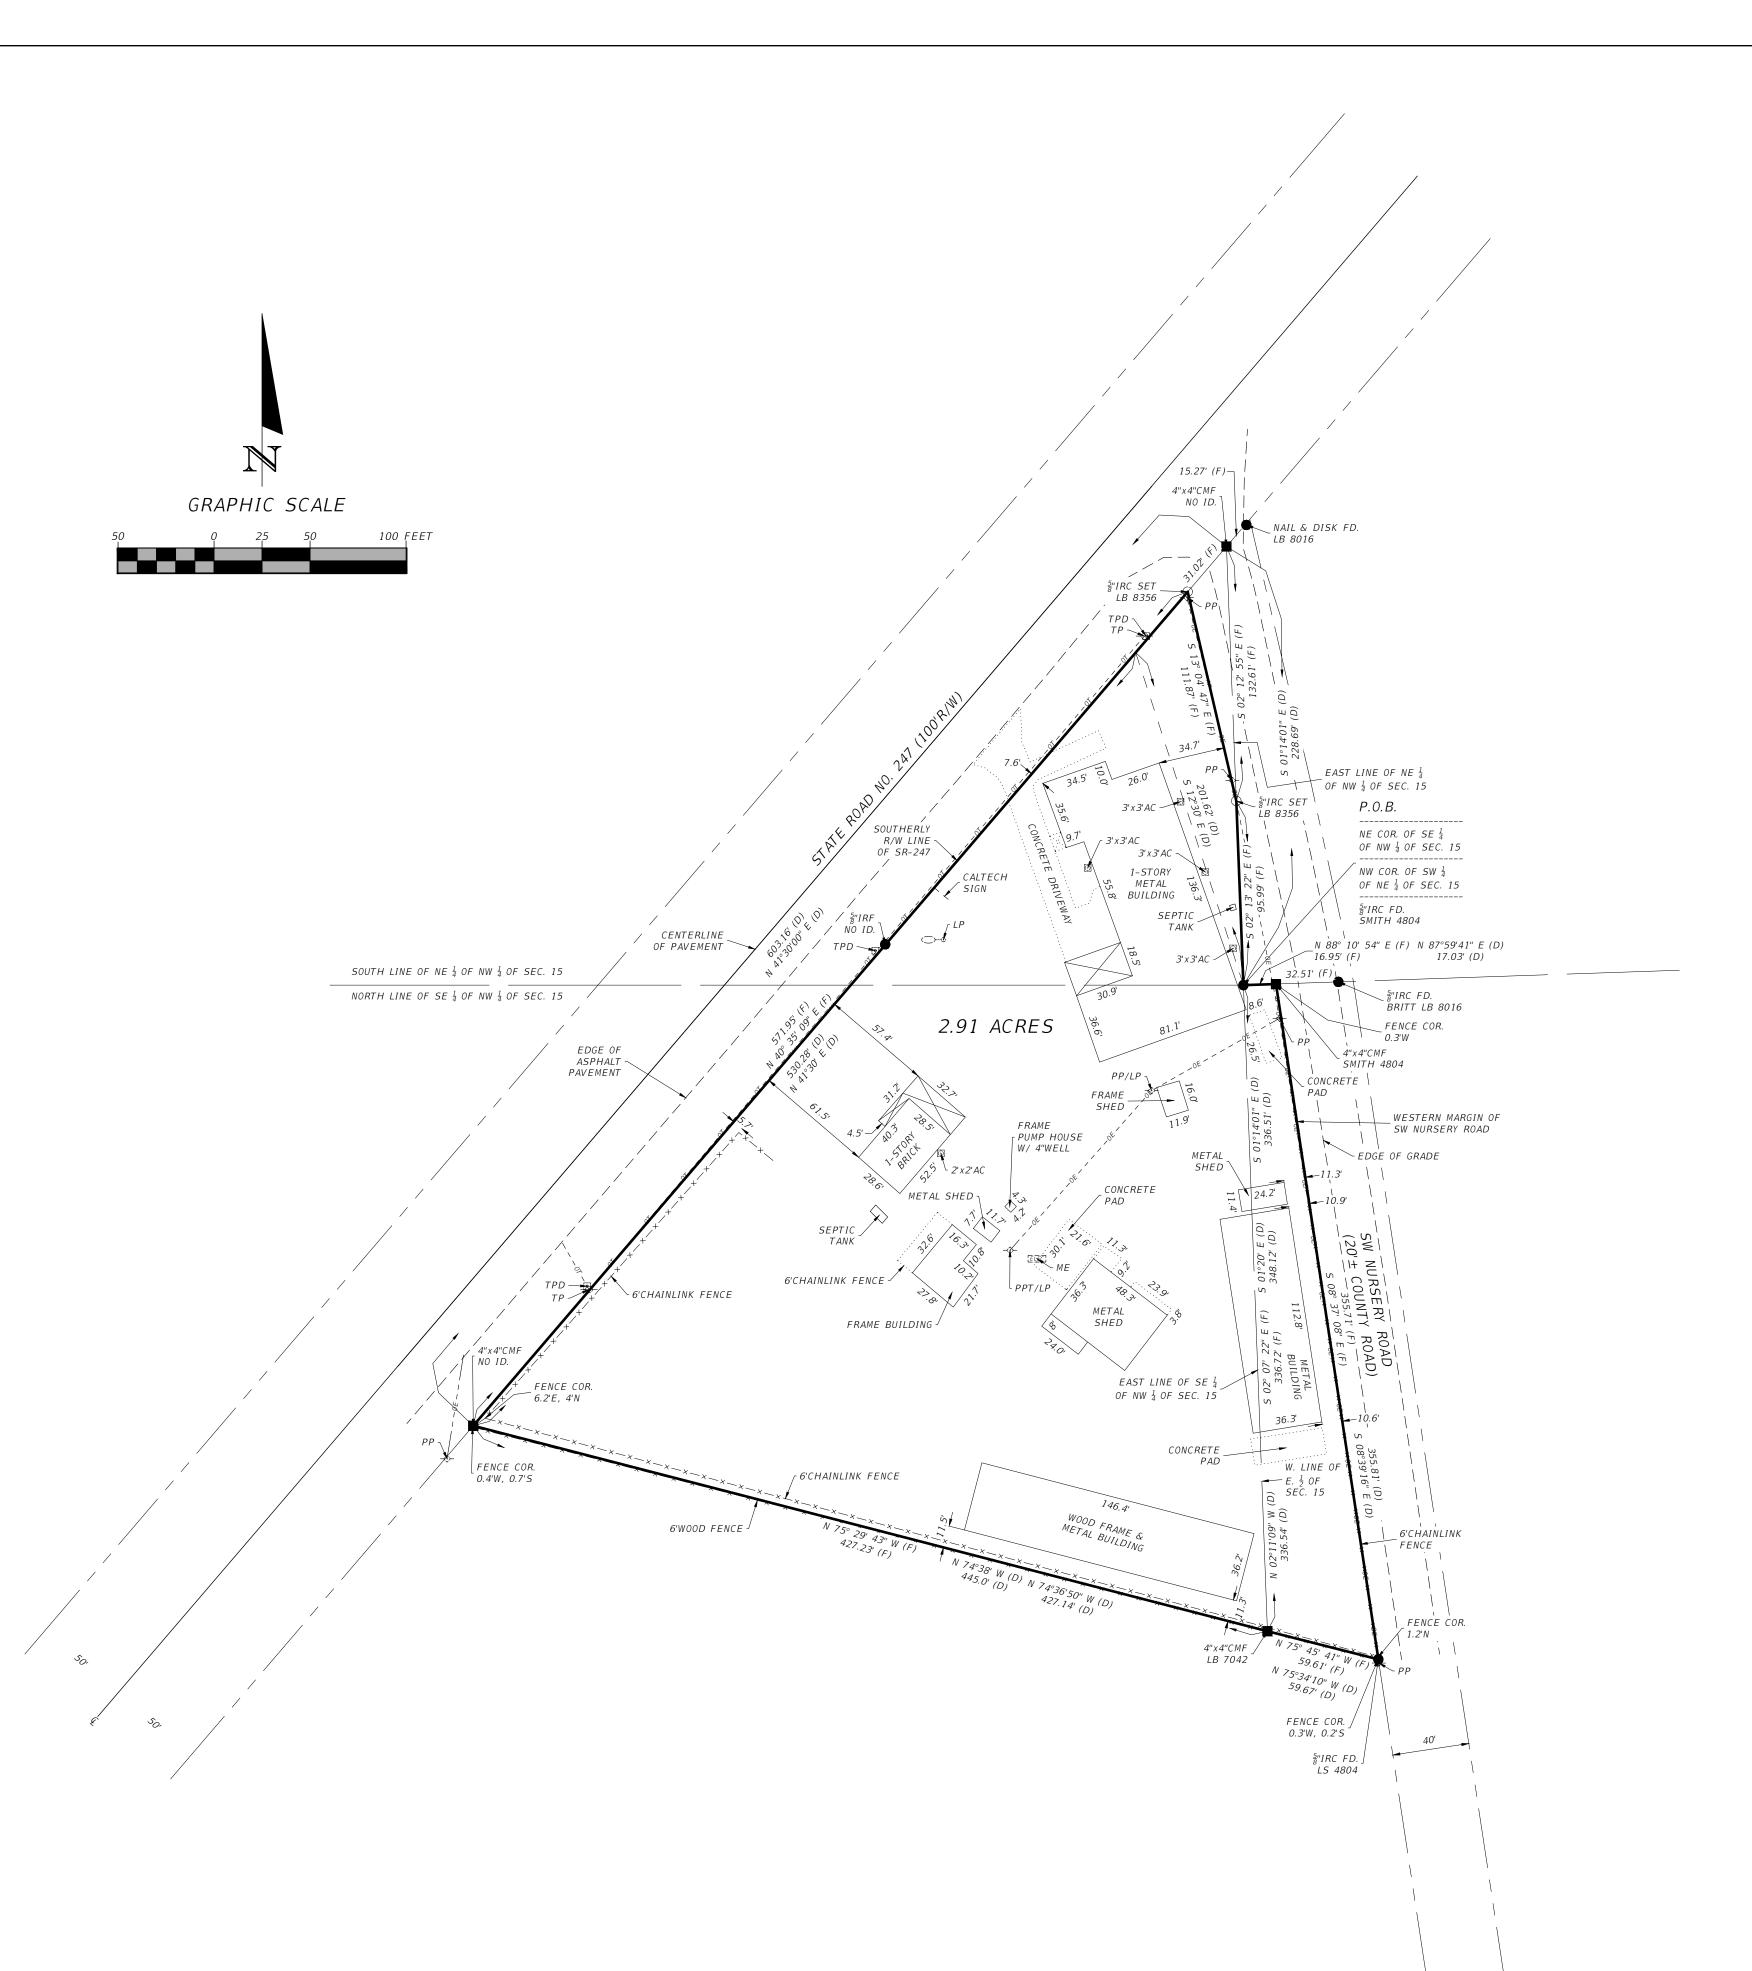

NOTES:

- 1.) Monumentation is as shown and designated on the face of the plat.
- 2.) Boundary based on monumentation found in place, instruction by client, latest deed of record, and prior surveys by Donald F. Lee & Associates, Inc.
- 3.) Bearings based on State Plane Coordinates.
- 4.) Interior improvements shown were located by field ties.
- 5.) Underground encroachments, if present, were not located with this survey.
- 6.) This survey was made without benefit of a title search. There may be additional easements, restrictions, etc. not shown hereon but found in the Public Records. Issues regarding title, land use & zoning, easements & other encumberances are not a part of the scope of a Boundary Survey and can only be revealed with a title search.
- 7.) Date of field survey completion: April 10, 2025
- 8.) Examination of the Flood Insurance Rate Maps (FIRM) for Columbia County shows that, per said maps, the described parcel lies within Flood Zone "X", which according to said maps is outside of the 0.2% chance floodplain (ref: Map No. 12023C0289D,12023C0290D).

LEGEND SEC.=SECTION PP=POWER POLE PLS=PROFESSIONAL LAND SURVEYOR TP=TELEPHONE POLE COR.=CORNER OT=OVERHEAD TELEPHONE P.S.M.=PROFESSIONAL SURVEYOR & MAPPER TPD=TELEPHONE PEDESTAL R/W=RIGHT-OF-WAY R=RADIUS OF CURVE FD.=FOUNDPL = PROPERTY LINE L=LENGTH OF CURVE LB=LICENSED BUSINESS NO ID=NO IDENTIFICATION P.O.B.=POINT OF BEGINNING CB=CHORD BEARING Δ=DELTA ANGLE, CENTRAL ANGLE CD=CHORD DISTANCE IRC=IRON REBAR & CAP CHLK.=CHAINLINK IRF=IRON REBAR FOUND AC=AIR CONDITIONER CMF=CONCRETE MONUMENT FOUND (F)=FIELD MEASUREMENT 0E=0VERHEAD ELECTRIC (D)=DEED MEASUREMENT LP=LIGHT POLE

DESCRIPTION:

(Official Records Book 1341, Page 2454) TOWNSHIP 4 SOUTH - RANGE 16 EAST Section 15: BEGIN at Northeast corner of Southeast $\frac{1}{4}$ of Northwest $\frac{1}{4}$, and run thence South 1°20' East along East line of said Southeast $\frac{1}{4}$ of Northwest $\frac{1}{4}$, 348.12 feet; thence run North 74°38' West, 445.0 feet to Southerly right-of-way line of State Road #247; thence run North 41°30' East along said Southerly right-of-way line, 530.28 feet; thence run South 12°20' East, 201.62 feet to the POINT OF BEGINNING. Said lands lying in Southeast $\frac{1}{4}$ of Northwest $\frac{1}{4}$, and Northeast $\frac{1}{4}$ of Northwest $\frac{1}{4}$, Section 15, Township 4 South, Range 16 East, Columbia County, Florida.

ALSO and more particularly described as: BEGIN at the Northeast corner of the Southeast $\frac{1}{4}$ of the Northwest $\frac{1}{4}$ and run South 1°14′01″ East along the East line of said Southeast $\frac{1}{4}$ of the Northwest $\frac{1}{4}$ a distance of 336.51 feet; thence North 74°36′50″ West a distance of 427.14 feet to a point on the Southerly right-of-way line of State Road 247; thence North 41°30′00″ East along said Southerly right-of-way line a distance of 603.16 feet to a point on the East line of the Northeast $\frac{1}{4}$ of the Northwest $\frac{1}{4}$; thence South 01°14′01″ East along said East line a distance of 228.69 feet to the POINT OF BEGINNING. Containing 2.65 acres, more or less.

ALSO: All that part of the Southwest $\frac{1}{4}$ of the Northeast $\frac{1}{4}$ of Section 15, Township 4 South, Range 16 East, Columbia County, Florida, particularly described as: BEGINNING at the Northwest corner of the Southwest $\frac{1}{4}$ of the Northeast $\frac{1}{4}$ of said Section 15, thence North 87°59'41" East 17.03 feet to a point on the western margin of Nursery Road (a county maintained grade with a 40 foot right-of-way); thence along and with said western margin, South 8°39'16" East 355.81 feet to a point; thence North 75°34'10" West 59.67 feet to a point on the Western line of the Eastern half of said Section 15; thence along and with said Western line of the Eastern half of Section 15, North 02°11'09" West 336.54 feet to the POINT OF BEGINNING. Containing 0.29 acres (12,631.76 square feet), more or less.

Tax Parcel No.: 15-4S-16-03015-000

LESS AND EXCEPT that part within the maintained right-of-way of SW Nursery Road.



James B Smith
Dis: CN-James B Smith
Dis: CN-James B Smith
dnQualifier=A01410C000001936845ED4A0002136
O=Unaffiliated, C=US
Date: 2025.04.21 16:22:28-04'00'

THIS ITEM HAS BEEN DIGITALLY SIGNED AND SEALED BY JAMES B. SMITH ON THE DATE ADJACENT TO THE SEAL.

PRINTED COPIES OF THIS DOCUMENT ARE NOT CONSIDERED SIGNED AND SEALED AND THE SIGNATURE MUST BE VERIFIED ON ANY ELECTRONIC COPIES.

NORTH FLORIDA PROFESSIONAL SERVICES INC. P.O. BOX 3823 LAKE CITY, FL 32056 CERTIFICATE OF AUTHORIZATION: 29011 JAMES B. SMITH, P.S.M. NO. 7355

THE ABOVE NAMED PROFESSIONAL SURVEYOR AND MAPPER SHALL BE RESPONSIBLE FOR THE FOLLOWING SHEETS IN ACCORDANCE WITH RULE 5J-17.062, F.A.C.

REVISIONS			
DATE DESCRIPTION	DATE	DESCRIPTION	
04/21/25 CLIENT NAME REVISED.			

NFPS & PH.

NORTH FLORIDA PROFESSIONAL SERVICES, INC. P.O. BOX 3823 2551 BLAIRSTONE PINES DR.

LAKE CITY, FL 32056 PH. 386-752-4675 LIC NO. LB8356 2551 BLAIRSTONE PINES DR. TALLAHASSEE, FL 32301 WWW.NFPS.NET JOB NO. L250408F0U CA# 29011

FOUNDATION PROFESSIONALS
OF FLORIDA, INC.

SHEET NO.